


600 Cecil Street Buchanan, Michigan 49107 Phone: 616-695-6831

FAX: 616-695-1304

Service Bulletin

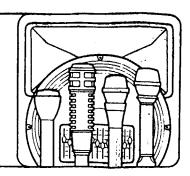

ELECTRO-VOICE

ENGINEERING FIELD NOTICE #3

DATE:

28 MARCH 1994

DISTRIBUTION:

FV FIFI D SERVICE REPRESENTITIVES

ITEM:

EQ-131, EQ-215, EQ-231 (ALL SERIAL NUMBERS

PREVIOUS 9412-XXXX)

SUBJECT:

NOISE

PROBLEM:

EQ'S MAY GENERATE AN UNACCEPTABLE AMOUNT OF

NOISE

SOLUTION:

REPLACE FOUR RESISTORS TO MODIFY EQ GAIN

STRUCTURE

MATERIAL REQUIRED: 2-4.12KΩ, 1% RESISTORS P/N A47-03-108444

2- 8.66KΩ. 1% RESISTORS P/N A47-03-124667

1- PRESSURE SENSITIVE LABEL

TIME REQUIRED:

~ 30 MINUTES

PROCEDURE:

FOR EACH CHANNEL: LOCATE R118 (22KΩ) ON MAIN PRINTED CIRCUIT BOARD. REPLACE WITH 8.66ΚΩ LOCATE R145 (10KΩ) ON MAIN PRINTED CIRCUIT

BOARD. REPLACE WITH 4.12KΩ RESISTOR.

REASSEMBLE AND RUN PERFORMANCE TESTS. PLACE PRESSURE SENSITIVE LABEL BELOW SERIAL NUMBER

TO INDICATE MODIFICATION PERFORMED.

CONTACT:

JOSEPH FISCHER, EV, (616) 695-6831